Full Surface Geared Hinges

SL57 85" HD600

All dimensions are measured in inches and [millimeters] from the top of the door to the centerline of the holes and bearings.

Dimensions shown inside boxes ☐ are frame facing mounting screw holes.

Choose location for CTW prep from bearing slots dimensioned. CTW4/5 = 1 location; CTW8/10 = 2 locations; CTW12 = 3 locations.

SL57 Profile

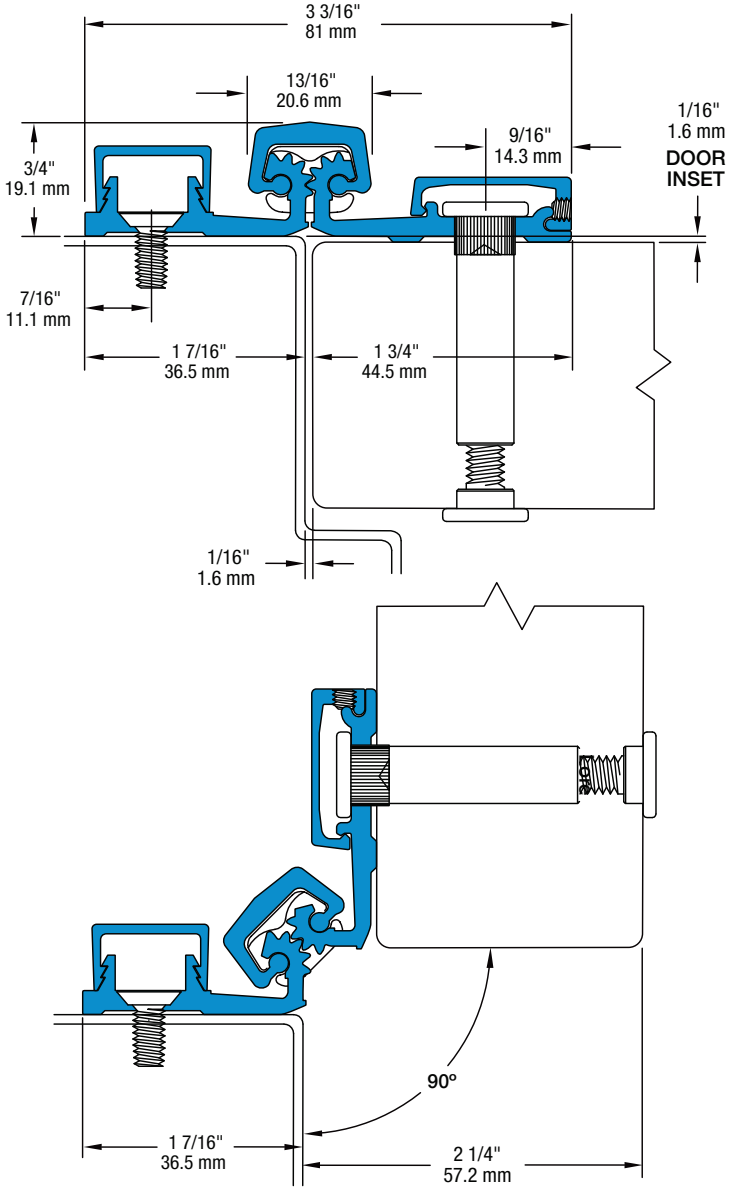

CTW Prep Location Dimensions

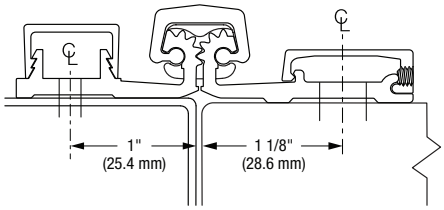

A 3/8" (9.5 mm) clearance hole is required in the door and frame for the CTW wires.

24 fasteners / 32 bearings

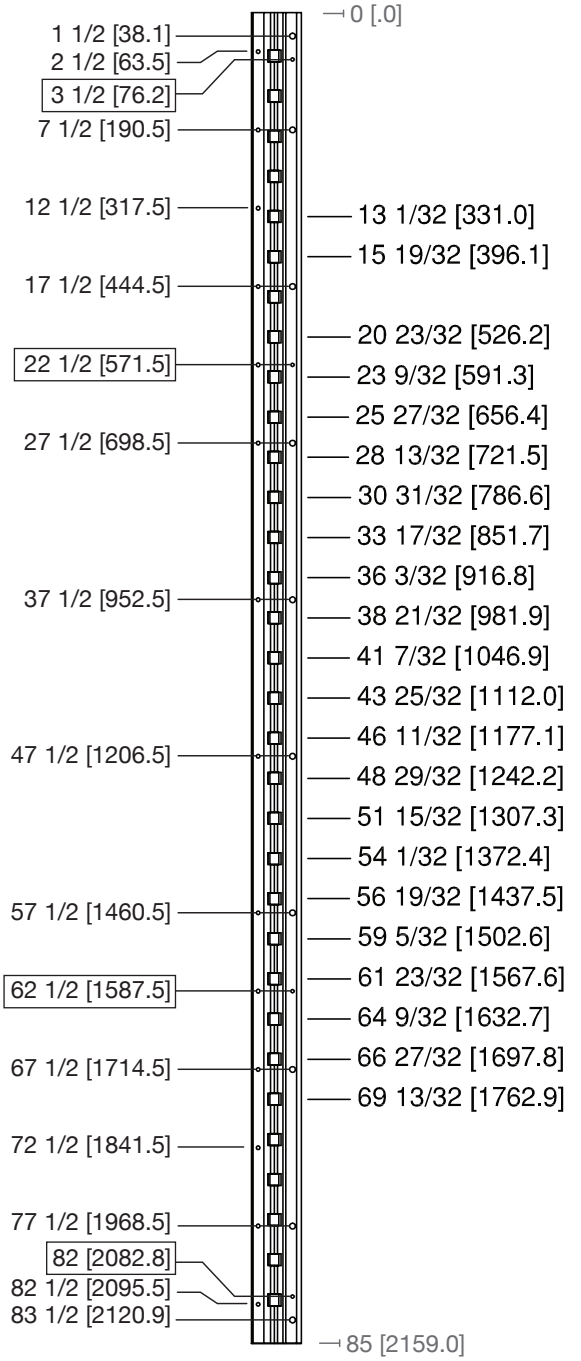

© 2026 SELECT Products Limited 043026