

Full Surface Geared Hinges


SL57 120" HD600

All dimensions are measured in inches and [millimeters] from the top of the door to the centerline of the holes and bearings.


Dimensions shown inside boxes are frame facing mounting screw holes.

Choose location for CTW prep from bearing slots dimensioned. CTW4/5 = 1 location; CTW8/10 = 2 locations; CTW12 = 3 locations.

SL57 Profile

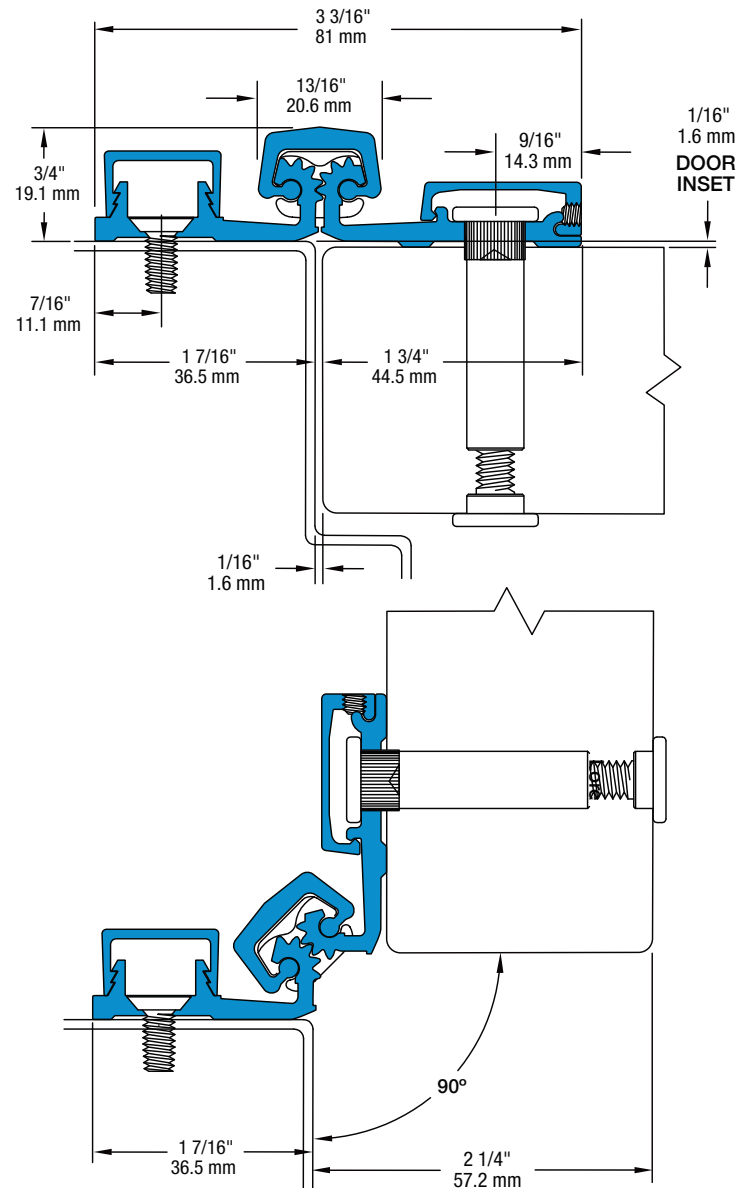

CTW Prep Location Dimensions

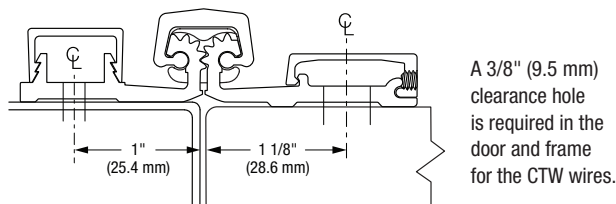

32 fasteners / 47 bearings

HOLE LOCATIONS **CTW BEARING LOCATIONS**

1 1/2 [38.1]	→ 0 [.0]
2 1/2 [63.5]	
3 1/2 [76.2]	
7 1/2 [190.5]	
12 1/2 [317.5]	—11 5/16 [287.5]
17 1/2 [444.5]	—13 7/8 [352.6]
	—16 7/16 [417.6]
	—19 [482.7]
22 1/2 [571.5]	—21 9/16 [547.8]
	—24 1/8 [612.9]
27 1/2 [698.5]	—26 11/16 [678.0]
	—29 1/4 [743.1]
	—31 13/16 [808.2]
	—34 3/8 [873.3]
37 1/2 [952.5]	
	—39 1/2 [1003.4]
	—42 1/16 [1068.5]
	—44 5/8 [1133.6]
47 1/2 [1206.5]	
	—49 3/4 [1263.8]
	—52 5/16 [1328.9]
	—54 7/8 [1394.0]
57 1/2 [1460.5]	
	—60 [1524.1]
62 1/2 [1587.5]	
	—65 1/8 [1654.3]
	—67 11/16 [1719.4]
	—70 1/4 [1784.5]
72 1/2 [1841.5]	
	—75 3/8 [1914.7]
	—77 15/16 [1979.7]
	—80 1/2 [2044.8]
82 1/2 [2095.5]	
	—85 5/8 [2175.0]
	—88 3/16 [2240.1]
	—90 3/4 [2305.2]
92 1/2 [2349.5]	
	—93 5/16 [2370.3]
	—95 7/8 [2435.4]
97 1/2 [2476.5]	
	—98 7/16 [2500.4]
	—101 [2565.5]
102 1/2 [2603.5]	
	—103 9/16 [2630.6]
	—106 1/8 [2695.7]
107 1/2 [2730.5]	
	—108 11/16 [2760.8]
112 1/2 [2857.5]	
117 [2971.8]	
117 1/2 [2984.5]	
118 1/2 [3009.5]	
	→ 120 [3048.0]